


ORACLE[®]


LIGHTING TECHNOLOGY



GM TRUCK LED LIGHT BAR KIT #5700 INSTALLATION GUIDE

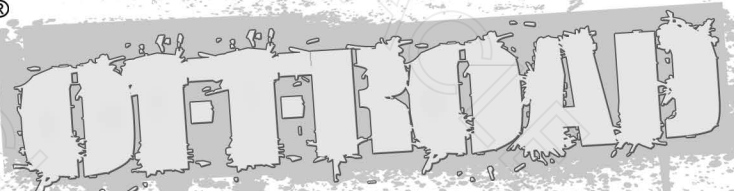

- CONTENTS:**
- (2) 40W Light Bars
 - Mounting Hardware
 - (2) Wiring Harness
 - LED Rocker Switch

TOOLS: 7mm, 17mm 

Step Drill 

Cutters 



Step 1- Remove the Upper Bumper Cover. Begin by removing (2) 7mm bolts from each wheel well & clip retainers under the hood. Once all bolts & clips are removed the grill and cover will pull off.



Step 2- With the Bumper Cover removed you can now drill out the two mounts for the LED Light Bars to attach. You will need to drill a 1/2" hole through the metal bumper to attach the Light Bars.

Step 3- Insert Light Bar Stud into the mount (from underside) and bolt in place. Check Light alignment with bumper opening. If the Light Bar must be lowered use included washers for spacing.



Step 4- Now with the Light Bars in place you can set the vertical adjustment level. Use a 13mm socket to loosen the adjustment nut and tighten once the beam is aimed at a satisfactory level.

Step 5- Before reinstalling the bumper cover you will need to trim off the tabs that insert into the mount now occupied by the Light Bar mount. Bumper cover installation steps are reverse of removal.

